

DETAILS OF INSPECTION VIOLATIONS

No	Ref	Pts	Critical	Description.	Corrective Actions Taken
1	05	0	Yes	Potable water. Far point halogen analyzer	Probe has been changed and all monitoring equipment related accurately checked.
2	08	0	No	Potable water. Water bunker hoses were not capped or coupled together. All hoses had aluminum foil covering the end	All hoses are coupled together. Aluminum foil will not be used as cap any more.
3	22	0	No	La Veranda Café Galley - Dish wash machine. The data plate on the hood type dishwashing machine stated a final rinse time of 11 seconds. It did not appear that the final rinse ran for the full 11 seconds. The temperature of the unit did reach a final temperature of at least 160°F. It was stated that the dishwashing machine had variable settings for either plated or glasses and that the plate final rinse time was 11 seconds but the glass final rinse was less than 11 seconds. This was not indicated on the data plate and there was no indication on the operating selector to indicate the correct time for each type of dish.	A Hobart technician will visit the ship to ensure the rinse cycle, runs for the required. Data plates will be updated accordingly.

No	Ref	Pts	Critical	Description.	Corrective Actions Taken
4	33	0	No	Main galley. Some tiles at the Cold Galley had missing grouting, and made cleaning difficult.	This is currently underway and will be completed in due course.
5	37	1	No	Main Galley-Ware washer. Small build-ups of condensation were noted on the deck head over the ware washer clean receiving area.	The length of the curtains will be monitored and the exhaust will be strengthened. A Hobart technician will call upon to look at the overall Machine.
6	37	1	No	Crew Galley. The deck head above the rath ovens had heavy condensation.	The exhaust will be strengthened.
7	37	1	No	Crew Galley. Heavy condensation was noted above the ware washer.	A Hobart technician will call upon to look at the overall Machine.